



59.F0 Error Message

HP LaserJet M452 / M377MFP / M477MFP



The 59.F0 has been a common error code on the HP CLJ M452 and M377 / M477 MFP models. The printers service manual references this error to a “drum motor assembly” but in most cases has been resolved by replacing the Transfer Belt assembly (RM2-6454). The belts have an internal failure that the prevents the secondary transfer rollers from engaging, and need to be replaced as a whole unit.