



Motor Error Corrections HP M601/M602/M603

59.00.90 start-up or **59.00.A0** rotational

Feed motor (M101) failure

1. Reconnect the connector (J191) on the feed motor and the connector (J91) on the DC controller PCA.
2. Use the feed motor (M101) drive test in the Component test to verify that the motor is properly functioning. If it is not, replace the feed motor (M101). RM1-8285

59.00.30 start-up or **59.00.40** rotational

Fuser motor (M299) failure

1. Reconnect the connector (J221) on the feed motor and the connector (J89) on the DC controller PCA.
2. Use the fuser motor (M299) drive test in the Component test to verify that the motor is properly functioning. If it is not, replace the fuser motor (M299). RM1-5051

59.05.50 start-up or **59.05.60** rotational

Drum motor (M102) failure (start-up or rotational)

1. Reconnect the connector (J187) on the drum motor and the connector (J87) on the DC controller PCA.
2. Use the drum motor (M102) drive test in the Component test to verify that the motor is properly functioning. If it is not, replace the drum motor (M102). RM1-8358