



HP P4015 Series Motor Errors

As the manual lists 59.XY motor errors to check cables and enter the DIAGNOSTICS menu to find which motor is not functioning properly, will only work for motor “start up” errors not “rotation” errors. So a clear description of motor errors as follows:

59.00 – feed motor start up failure (connector J 91) RL1-1657

59.01 - feed motor rotation up failure (connector J 91) RL1-1657

59.02 – fuser motor start up failure (connector J 89) RM1-5051

59.03 - fuser motor rotation failure (connector J 89) RM1-5051

59.04 – drum motor start up failure (connector J87) RL1-1659

59.05 - drum motor rotation failure (connector J87) RL1-1659